
VIN: ████████ Vehicle: 3' / E90 / Sedan / 325i / N52 / MANUAL / USA left-hand drive / 2006 / 04
System version: 2.38.8 Data version: 2.38.0

Correct reset of the engine oil service not possible

The following fault pattern is known :

The engine oil service cannot be correctly reset for vehicles with a mileage/km of more than 300000 km.

After the reset the remaining distance is either 0 km or considerably too low.

Once the vehicle has been driven beyond the remaining distance the driver is alerted continuously via the red service indicator that the engine oil service is due.

In the event of a customer complaint, please proceed as follows:

Do not replace any components Programming work will not help.

In the event of a fault, the CBS engine oil service display in the instrument panel must be deactivated.

To do this, go to the service functions and select the following path:

- "04 Maintenance and pre-delivery check
- "CBS correction of vehicle data"
- "Deactivation, engine oil"

Carry out "SCBS_6006 engine oil deactivation" testing procedure! Important: Deactivation is only possible with kilometre readings greater than 300000 km!

Note: The vehicle must be serviced at fixed intervals in future. Please inform the customer accordingly!

If programming or encoding is carried out after deactivating the CBS engine oil service display, the CBS engine oil service display will be active again in the instrument panel. In this case, the "SCBS_6006" testing procedure must be carried out again.

8/26/2013